



2000-2017 GM ECOTEC 2.0/2.2/2.4L DOHC M11X1.5 HEAD BOLT THREAD REPAIR

11 M11X1.5 MODIFIED inserts are supplied in this kit (10 are required for this application)

IMPORTANT! Please read the “*UNIVERSAL INSTALLATION GUIDE*” provided in the kit in their entirety before proceeding. Details specific to repairing this engine regarding drilling & tapping depths along with insert installation depths are provided below.

*****DO NOT RE-USE OLD HEAD BOLTS*****

The threads on the old head bolts are often stretched out of pitch from torquing, causing them to tighten prematurely in the new inserts.

1. When mounting the drill/tap jig, follow the instructions on pages 3&4 using the TALL spacer provided (1½in. diameter x 1.650in. Long) with the recessed end of the spacer facing downward. If it is necessary to mount the jig to a hole that has just been repaired, make sure to use a new head bolt, otherwise an old head bolt may tighten up prematurely in the new insert since the threads of the bolt may be stretched out of pitch.
2. Drill the holes 3” (83mm) deep from the deck surface which is approximately the total depths of the original holes.
3. The inserts are to be installed 1 in. (25mm) deep from the deck surface (see page 4, figure 4 of the Installation Guide). To accomplish this, you will need to thread the holes about 2 ¾ in. deep from the deck surface.

Note: This kit is universal for many other engines as well since the outside thread size of the insert does not change. Inserts are also available with internal threads of M10x1.25, M10x1.5, M11x1.25, M11X2.0, M12X1.25, M12x1.5, M12X1.75 and 7/16-14.